

OFFICE OF THE EXECUTIVE ENGINEER, PWD DN III PRATAPGARH

No. 915

Dated: 4/12/19

BUILDING SAFETY CERTIFICATE

The Building of Regional Teachers Training College Dhamotar, Disst. Pratapgarh. inspected by under signed along with Assistant Engineer Sub. Div. Thada, Junior Engineer on 04.12.2015. The Building has been constructed by private agency and the structural details are not available how ever no cracks/settlements observed. The safety certificate is issued subject to following necessary steps to be taken

Block A

1. Duct in room no. 4 & 5 have not been covered with grill on every floor and there are chances of student falling down resulting in fatal engry.
2. Passage on 1st and 2nd floor masonry upto sill level and there is clear opening between sill level and bottom of beam at roof level. This opening should be covered with grill to avoid any accident.
3. 2nd Floor Hall & Room ceiling plaster has peeled out and fallen at many places need to be repaied.
4. In Chemistry lab at 2nd floor cross ventilation not provided hans the alluminium gate has been thrown out. Proper cross ventilation to be provided before fixing gate.
5. Lift well is incomplete hense opening for door be closed with brick massonary to avoid any accidental stepping in the open well.

Block B

1. Work of 2nd floor and 3rd floor is in progress. Flooring, Fixing of doors and windows is in progress.
2. Electrical fitting to be completed. Loose wiring observed which need rectification.
3. Stair case railing from 1st floor to 3rd floor not provided and stone flooring for riser and tread to be fixed.

- 4. Outer plaster of 2nd and 3rd floor is partly completed and roof treatment is yet to be done.
- 5. Opening in passages need to be covered with grills.

Block C

- 1. Cafeteria and mechanical work shop complete

Block D


- 1. Hostel work is in progress only structure has been completed. Flooring, joinery, Sanitary and electrical work yet to be done.

Boundary wall is incomplete and entrance gate-yet to be fixed.

Safety measures while construction at 1st 2nd and 3rd floor to be adopted.

Enclosed :- Drawing duly verified

Yours faithfully

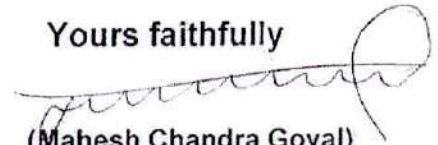

(Mahesh Chandra Goyal)
Executive Engineer,
PWD DN III Pratapgarh